

<b>Technical Bulletin</b>		<b>Model</b> 6 Cyl.	<b>Group</b> 2
<b>Subject</b>	<b>Coding ECM (DME) for 911 Carrera with Tiptronic Transmission</b>	<b>Part Identifier</b> 2470	<b>Number</b> 9602

**ATTENTION: Service Manager / Service Technician**

**Models Affected:** *911 Carrera Model Year 1996*



**Concern:** As of Model Year 1996, the **spare parts ECM (DME)**, part number 993 618 604 00, is coded for manual transmission vehicles. If this control unit is installed in a vehicle with Tiptronic transmission, the ECM must be recoded accordingly. If the ECM is installed in a vehicle with Tiptronic transmission and not coded to a Tiptronic vehicle, the MIL will illuminate.

**Coding of the ECM (DME) to a Tiptronic vehicle is a one time option. ONCE THE ECM HAS BEEN CODED TO WORK IN A TIPTRONIC VEHICLE, IT CAN NOT BE RE-CODED TO WORK IN A MANUAL TRANSMISSION VEHICLE. Please keep this in mind when swapping ECM's from other vehicles for test purposes.**

It is not necessary to code the spare parts ECM for manual transmission vehicles.

**Coding:** Coding of the ECM (DME) is done by the system tester 9288 in the following manner:

- Connect system tester 9288 to the vehicle.
- Select vehicle type "911", then select "DME".
- Select "Actual Values" from the menu, then page forward until the screen with coding is displayed and select "coding".
- The system tester will display one of the following screens depending on the type of transmission installed in the vehicle.

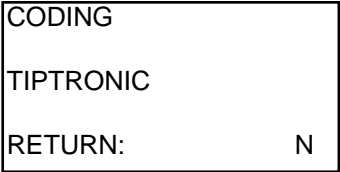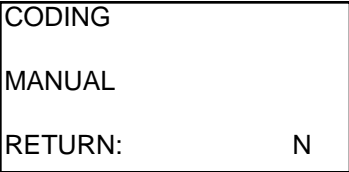

- Once one of the above screens has been displayed, **the coding is done automatically by the system tester without any action by the technician.**
- Exit from the system and remove the tester from the vehicle.

**Important Notice:** Porsche Cars N.A Technical Bulletins are intended for use by professional technicians, not a "Do-it-yourselfer." They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Special tools may be required to perform certain operations identified in these bulletins. Use of tools and procedures other than those recommended in these bulletins may be detrimental to the safe operation of your vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your Porsche Dealer for information on whether your vehicle may benefit from the information. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify correct part numbers. ©1996 Porsche Cars North America, Inc.

Dealership	Service Manager _____	Shop Foreman _____	Service Technician _____	_____	_____
Distribution	Asst. Manager _____	Warranty Admin. _____	Service Technician _____	_____	_____
Routing					

The trademarks Porsche®, Targa®, Carrera®, Tiptronic®, Varioram® and the Porsche Crest are registered trademarks of Dr. Ing. h.c.F. Porsche AG and its affiliate, Porsche Cars North America, Inc.