

<h1>Technical Bulletin</h1>	Model 6 Cyl.	Group 3
Subject Manual Transmission Pinion and Main Shaft Locking Nuts	Part Identifier 3575	Number 9505


ATTENTION: Service Manager / Service Technician

Models Affected: **911 Carrera Model Year 1995**
911 Carrera 4 Model Year 1995

Concern: The new style lock nut for transmission shafts without an indentation for the locking collar is presently not available. Loctite 243 must be used. This involves the following transmissions:

G50.20/21 - 911 Carrera
G64.20/21 - 911 Carrera 4

General Information: From April 1995, manual transmissions no longer have an indentation for the locking of the hexagon nut on the main shaft and pinion shaft. In these cases, use the early version lock nut and Loctite the lock nut to the transmission shaft(s) using **LOCTITE 243**, part number PNA 043 243 00. It is not necessary to stake the locking collar on the locking nuts when using Loctite 243.

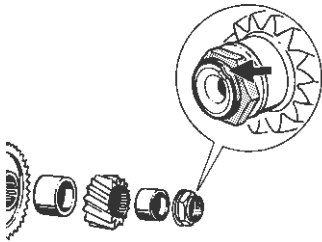

Loctite 243 may not be commonly available through most automotive parts suppliers, however it is available from PCNA, under part number PNA 043 243 00 (10ml) and may be order through your parts department.

Parts Information:	EARLY VERSION LOCK NUTS (AVAILABLE)	LATE VERSION LOCK NUTS (NOT YET AVAILABLE)
	999 034 024 00	999 034 034 00
	999 034 027 00	999 034 035 00
	915 302 281 00	- - - - -

Important Notice: Porsche Cars N.A Technical Bulletins are intended for use by professional technicians, not a "Do-it-yourselfer." They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Special tools may be required to perform certain operations identified in these bulletins. Use of tools and procedures other than those recommended in these bulletins may be detrimental to the safe operation of your vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your Porsche Dealer for information on whether your vehicle may benefit from the information. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify correct part numbers. ©1995 Porsche Cars North America, Inc.

Dealership Distribution Routing	Service manager _____ Asst. manager _____	Shop foreman _____ Warranty admin. _____	Service technician _____ Service technician _____	_____	_____	_____	_____
---------------------------------------	--	---	--	-------	-------	-------	-------

The trademarks Porsche®, Targa®, Carrera®, Tiptronic®, Variocam® and the Porsche Crest are registered trademarks of Dr. Ing. h.c.F. Porsche AG and its affiliate, Porsche Cars North America, Inc.